


Radon Test Report

Location:	XXXX NE 2	8 th Ave. Portla	and, OR 972	211				
Client:	XXX X							
Start Date:	3-3-09	End Date:	3-5-09	Duration:	48 hrs.	Device Used:	CRM - 1028	

Overall Average:	35.2 pCi/L	
EPA Average:	36.6 pCi/L	
Recommendation: The radon levels are well above acceptable standards. It is recommended to		
mitigate the radon levels in this home		

The EPA recommended actions per radon levels.

Radon Level	Recommended Action
4 pCi/L or above	Recommend fixing the home
2-4 pCi/L	Consider fixing the home
2 pCi/L or below	Reducing levels below 2 is difficult.
1.3 pCi/L	Average indoor radon level
0.4 pCi/L	Average outdoor radon Level.

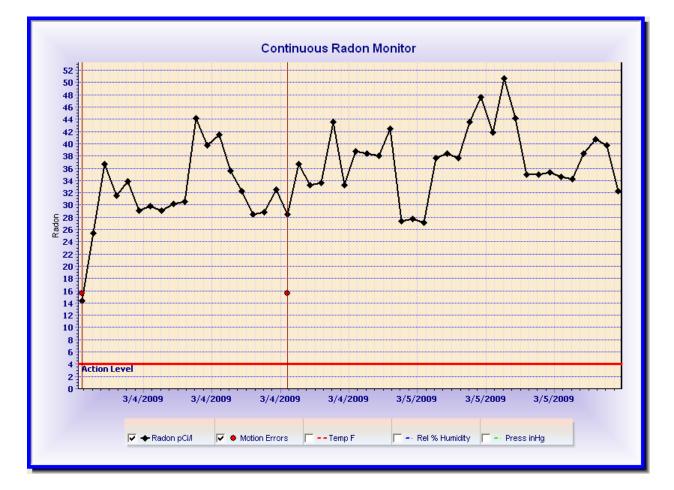

****** 03/03/2009 ******

Time	Counts Flags pCi/l		
18:35	14.4	Μ	
19:35	25.3		
20:35	36.7		
21:35	31.5		
22:35	33.9		
23:35	29.1		

******* 03/04/2009 *******

Time	0		
	pCi/l		
00:35	29.8		
01:35	29.1		
02:35	30.1		
03:35	30.5		
04:35	44.2		
05:35	39.7		
06:35	41.4		
07:35	35.6		
08:35	32.2		
09:35	28.4		
10:35	28.8		
11:35	32.5		
12:35	28.4 M		
13:35	36.7		
14:35	33.2		
15:35	33.6		
16:35	43.5		
17:35	33.2		
18:35	38.7		
19:35	38.4		
20:35	38.0		
21:35	42.5		
22:35	27.4		
23:35	27.7		

******* 03/05/2009 *******

Time	Counts Flags
	pCi/l
00:35	27.1
01:35	37.7
02:35	38.4
03:35	37.7
04:35	43.5
05:35	47.6

06:35	41.8
07:35	50.7
08:35	44.2
09:35	34.9
10:35	34.9
11:35	35.3
12:35	34.6
13:35	34.3
14:35	38.4
15:35	40.8
16:35	39.7
17:35	32.2

Error Flags: 0 M Motion: 2

PC Software Version: 2.1.1.0 Embedded Software Version: 104

Inspected by: James Fronsdahl

Date: March 18, 2009

Come Forwhall

While we inform you of the radon levels found, we have to rely on the government agencies that perform the scientific tests and laboratory studies for suggestions of repair. Because there is no known safe level of exposure to radon, with this initial test you can make your own informed decision as to the risks involved. For more information visit <u>www.epa.gov/radon</u>